

Technical Bulletin

Model
928, 928S

Group
40

Subject: Modified Lower Ball Joint Support and Mounting

Part Identifier
4036

Number
84-01

From September, 1983; VIN 92 ES 860404, lower ball joint support and mounting hardware is changed as follows:

- steel ball joint support instead of aluminum
- shorter studs in mounting brackets
- identical caster/camber adjusting eccentrics

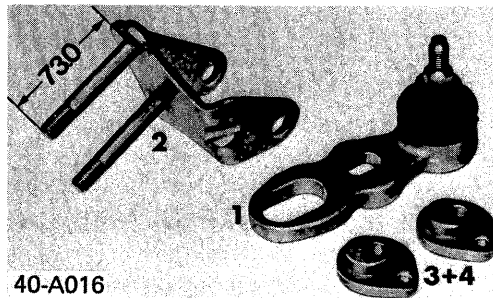


Fig. 1 New version

1. ball joint support
2. mounting bracket
- 3/4. caster/camber eccentrics

Note

Caster/camber holes in ball joint support have been switched. Caster is now adjusted with the inner eccentric and camber with the outer.


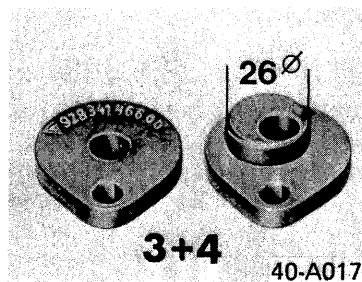


Fig. 2 Caster/camber adjusting eccentrics, new version

- New version eccentrics are identical and are stamped with the new part number

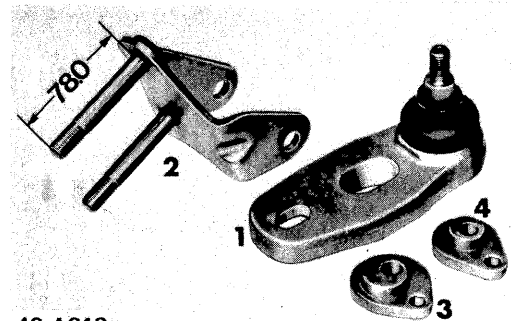

40-A018

Fig. 3 Previous version

1. ball joint support
2. mounting bracket
3. camber eccentric
4. caster eccentric

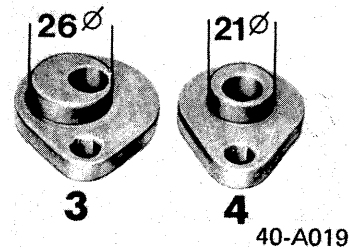


Fig. 4 Caster/camber adjusting eccentrics, previous version

New and old version component pieces may **not** be interchanged.

New version parts may be installed on one or both sides of an earlier vehicle, but initial installation requires use of following parts (see Fig. 1 and 2):

- | | | |
|------|------------------------------|----------------|
| 1. | Ball joint support | 928.341.049.12 |
| 2. | Bracket, left | 928.341.091.05 |
| | right | 928.341.092.05 |
| 3/4. | Camber/caster eccentrics (2) | 928.341.466.00 |

Note

Measurements are in millimeters.

SERVICE

Page 1 of 1
April 18, 1984